

Allied Motion Technologies, Inc. 495 Commerce Drive, Suite 3 Amherst, NY 14228 (716) 242-7535

# **User Manual:**

# DPFlex Gen 2 Sensorless Brushless Motor Drives

Document Part Number: 34-2003 R3





# Table of Contents

1.0	Equat	ions4
2.0	Figure	es
3.0	Tables	5
4.0	Prefac	:e5
5.0	Inspec	tion Upon Receipt
6.0	Safety	
7.0	Overv	iew6
8.0	Sensor	rless Drive Technology7
	8.1	Understanding Commutation
	8.2	Six-Step (Trapezoidal) Commutation
	8.3	Sensorless Six-Step Commutation
	8.4	Special Considerations for Sensorless Commutation
	8.5	Sensorless Startup
9.0	Wirin	g 10
	9.1	Power Cabling
	9.2	Motor Cabling
	9.3	Communications Cabling
10.0	Power	Dissipation12
11.0	Gettin	g Started13
	11.1	Included Software
	11.2	Installing the Software
	11.3	Connecting to the DPFlex
	11.4	Saving Configurations
	11.5	Loading New Firmware
12.0	Creati	ng Applications18
	12.1	Stimulus Tools



		12.1.1 Current Stimulus	19
		12.1.2 Velocity Stimulus	20
	12.2	Motor Parameters	21
		12.2.1 Motor Verification Tool	21
	12.3	Current Compensator	22
	12.4	Velocity Compensator	
	12.5	Inputs	
	12.6	Faults	27
	12.7	Registers	28
	12.8	Digital Output	29
	12.9	Using the Oscilloscope	30
13.0	Contro	ol Theory & Implementation	31
	13.1	Biquad Compensator	32
	13.2	Calculating Filter Coefficients	33
14.0	Contac	cts and Service	34
15.0	Revisio	on History	34



# 1.0 Equations

Equation 1: Transfer Function, Biquad Compensator, z-Domain	32
Equation 2: Transfer Function, PID Compensator, s-Domain	
Equation 3: Transfer Function, PID Compensator, z-Domain	
Equation 4: Biquad Compensator Coefficient A1	
Equation 5: Biquad Compensator Coefficient A <sub>2</sub>	
Equation 6: Biquad Compensator Coefficient B <sub>0</sub>	
Equation 7: Biquad Compensator Coefficient B <sub>1</sub>	
Equation 8: Biquad Compensator Coefficient B <sub>2</sub>	

# 2.0 Figures

Figure 1: Six-Step Commutation Phase Current and Back-EMF	7
Figure 2: Six-Step Commutation Sequence	
Figure 3: Power and Motor Wiring Diagram	11
Figure 4: Power Dissipation Curve, DPFlex, 24 V, 30 A Model	
Figure 5: Safe Operating Area, DPFlex, 24 V, 30 A Model	
Figure 6: Installation Utility, Main Menu	
Figure 7: Installation Utility, Install DP.D.	14
Figure 8: Installation Utility, Install USB-to-Serial Driver	
Figure 9: DP.D System Navigation Tree	
Figure 10: Interact Form	16
Figure 11: Connection Info Form	
Figure 12: Interact Form (With Enabled Connection)	17
Figure 13: DP.D System Navigation Tree (With Enabled Connection)	17
Figure 14: DPFlex Properties Form	
Figure 15: Current Stimulus Tool	
Figure 16: Velocity Stimulus Tool	
Figure 17: Motor Form	
Figure 18: Motor Verification Tool	
Figure 19: Current Compensator Form	
Figure 20: Current Compensator, Tuning Tools	
Figure 21: Oscilloscope, Current Loop Tuning	
Figure 22: Velocity Compensator Form	
Figure 23: Velocity Compensator, Tuning Tools	
Figure 24: Oscilloscope, Velocity Loop Tuning	
Figure 25: Inputs Form	
Figure 26: Faults, Status Form	
Figure 27: Faults, Configure Form	
Figure 28: Registers Form	
Figure 29: Digital Output Form	
Figure 30: Oscilloscope	
Figure 31: System Diagram	
Figure 32: Biquad Filter Diagram	



# 3.0 Tables

Table 1: Applicable Allied Motion Products	5
Table 2: Current Stimulus Tool, Instructions	19
Table 3: Velocity Stimulus Tool, Instructions	
Table 4: Registers Form, Instructions	
Table 5: Oscilloscope, Instructions	
Table 6: Revision History	

# 4.0 Preface

This manual describes the installation and operation of DPFlex Gen 2 sensorless brushless motor drives manufactured by Allied Motion Technologies, Inc.

Every effort has been made to ensure accuracy of information in this manual. However, Allied Motion assumes no responsibility for any errors or omissions. The information contained within this document is regularly reviewed and we welcome your critical evaluation and suggestions for improvement. Allied Motion reserves the right to modify all documentation without prior notice. Be sure to download the most recent revision of this manual from the company website.

This manual is supplied to the user with the understanding that it will not be reproduced, duplicated, or disclosed in whole or in part without the express written permission of Allied Motion Technologies, Inc.

Table 1: Applicable Allied Motion Products			
PRODUCT FAMILY	PART NUMBER	DESCRIPTION	

# 5.0 Inspection Upon Receipt

DPX-2043xxxx

**DPFlex Gen 2** 

All Allied Motion products are thoroughly inspected and tested before leaving the factory. Although our products are packaged with extreme care, it is important that the user complete a thorough inspection of the product upon arrival.

DPFlex Gen 2 Sensorless Brushless Motor Drives

Examine the condition of the shipping container and materials. If damage is found, notify the commercial carrier involved. It is the user's responsibility to file any necessary damage claims with the carrier. Our products are shipped EXW (ex works), unless other arrangements have been made. Allied Motion is not responsible for carrier mishandling.



#### 6.0 Safety



#### CAUTION: GENERAL WARNING

Read all provided documentation before assembly and commissioning. Failure or improper use of this equipment can cause property damage, personal injury, and death. The final responsibility for the safe use of Allied Motion products is solely that of the user.



#### CAUTION: HIGH VOLTAGE

When drives are powered, high voltages are present on the connector and elsewhere in the drive and can be dangerous. The drive cover should not be removed with the power on, and then only by a competent and trained engineer. It is important that all system components be properly grounded.



#### CAUTION: HOT SURFACE

When drives are powered, the heat sink and internal components can become very hot. The drive cover should not be removed until cool, and then only by a competent and trained engineer.

#### 7.0 Overview

The DPFlex system includes the following components: the product datasheet, this user manual, the DPFlex drive, DP.D commissioning software, and cabling for connecting a DPFlex drive to power, motor, and personal computer (PC).

The DPFlex drive provides sensorless torque and/or velocity control of rotary brushless DC (BLDC) motors at performance levels exceeding those of conventional Hall sensor commutated drives. DPFlex detects motor rotor position at stall through an innovative algorithm based on motor phase-inductance measurement, thus no commutation sensors are required. The DPFlex may be integrated into a motor (e.g. into the bell end) or mounted separately.

Allied Motion's DP.D software for Microsoft® Windows® 2000/XP/Vista/7/8 is used to tune, configure, and program the DPFlex drive. It provides I/O setup and configuration tools, along with motor verification and performance analysis tools.

DPFlex is suitable for a wide range of applications including control of fans, pumps, compressors, centrifuges, drills, mills, conveyors, office and medical equipment, automotive subsystems, and many others. See datasheet for further explanation of product features, benefits, and specifications.



### 8.0 Sensorless Drive Technology

# 8.1 Understanding Commutation

Torque in an electric motor is the result of the interaction between two magnetic fields, one from the rotor and the other from the stator. These two magnetic fields must move in sequence with each other to produce torque. Sequentially controlling current through the motor so as to produce torque is what is known as commutation. To accomplish this, the DPFlex uses a sensorless six-step (trapezoidal) commutation method which relies on the motor's back electromotive force (back-EMF) for position sensing.

# 8.2 Six-Step (Trapezoidal) Commutation

In this method, there are only two of three phases of stator coils energized by the DC source at any one given time. To complete one electrical cycle or magnetic field rotation, every phase is energized four times (two times in the positive polarity and the other two in the negative polarity). BLDC motors are commutated by six 60 degree steps during each full 360 degree electrical cycle. Because the transition from one step to the next is discrete, the waveform of the field is shaped like a trapezoid.



Figure 1: Six-Step Commutation Phase Current and Back-EMF

Six-step commutation is simple and can be used for many types of BLDC motors. The simplicity and effectiveness of the method makes it an attractive choice for commutation even at high speed.



# 8.3 Sensorless Six-Step Commutation

Once the shaft of the motor is spinning sufficiently fast, the induced back-EMF voltage caused by the time varying magnetic flux linking the stator windings can be measured by the drive. This magnetic flux is produced from the permanent magnets of the rotor. It is possible to use this information to commutate the motor without any other position feedback information. This is what is meant by the term sensorless: it is the absence of any physical position feedback devices in the motor.

During six-step commutation, the coils that are energized are the two that yield the maximum developed electromagnetic torque. For a WYE connected motor, the third coil is off and so the back-EMF voltage can be measured at its phase terminal. Each of the three coils is energized (ON) for 120 electrical degrees and is then de-energized (OFF) for 60 electrical degrees. This pattern is repeated again and again every 180 electrical degrees and the current is switched in direction at each 180 degree segment.



Figure 2: Six-Step Commutation Sequence

The back-EMF voltage induced while in the OFF phase undergoes a polarity reversal during the time the phase is OFF. The bias voltage is the voltage of the neutral point of the WYE connection. Ideally, the drive should shut OFF a coil as the induced back-EMF across that coil is undergoing a polarity reversal. The coil should then be re-energized once the voltage has changed polarity and that coil can contribute to torque production. In order to do this, the controller samples the voltage of the OFF phase once the current in that phase has dropped to zero. Once it detects that the rotor flux is generating a back-EMF of the proper polarity, it shuts OFF the coil that is just beginning to go through this voltage reversal process and energizes the one that just finished this process.



The drive uses the physical properties of the motor to assess when the time for switching is appropriate. The motor back-EMF constant (Ke) of the motor is used to calculate how much flux there is per pole. By integrating the induced back-EMF voltage in the OFF phase and waiting for the proper amount of flux to accumulate, the drive can commutate at the appropriate time. Since Ke is constant, it is speed independent and therefore applicable at all speeds at which the back-EMF of the motor can be detected by the drive.

# 8.4 Special Considerations for Sensorless Commutation

During the process of commutation, current in one phase must drop to zero and be transferred to the phase that is just coming ON. Because of the fact that the coils are not mutually coupled 100%, and that each coil has its own leakage reactance, there will be a portion of time, albeit brief, where all three coils have current in them. During this period of time, an accurate back-EMF cannot be obtained from the voltage sense circuit on the controller.

Immediately after commutation, the drive will shut OFF the phase voltage and wait until it determines that an accurate back-EMF signal can be obtained from the analog input dedicated to back-EMF sensing in the OFF phase.

It is only after this has been successfully detected that the drive will begin to use the measured back-EMF for commutation purposes. Since DPFlex monitors the back-EMF feedback and activates the back-EMF sensing itself, there is no parameter associated with the coil-coil current transfer.

# 8.5 Sensorless Startup

As the induced back-EMF is proportional to speed, a sensorless controller needs a means of finding the rotor position at stall in order to start the motor and accelerate it to a sufficiently high speed to be able to detect the back-EMF voltage. Startup is undoubtedly the biggest hurdle for any sensorless control algorithm.

Conventional methods drive a current through the motor windings in order to force the rotor into a known position to ensure proper motor start. This can cause up to 180 degrees of motor rotation in the direction opposite to that which is actually desired. Also, the current required to orient the rotor depends on the inertial and frictional load of the motor. If the initial current to orient the motor is too high, there may be overshoot and ringing in the system. If the current is too low, the motor may not start at all. Such a system is not robust with respect to system load conditions.

More advanced methods determine rotor position based on the motor-phase saturation inductance change. The drive generates six short and opposing current pulses that drive the motor phases into saturation. The drive calculates the motor rotor position based on the saturation inductance change in each phase. Allied Motion refers to this procedure as the Ping Method. The rotor remains stationary during the initial ping period because the current pulses are short and in opposing sequence. In most cases, the motor reaches



sufficient speed before the next commutation sector change for the back-EMF commutation algorithm to take over. In a few cases, usually if the load on the motor is extremely heavy, the ping process repeats while the motor rotates at low speeds below the back-EMF commutation threshold. This is possible because the ping period time is negligible with respect to the time between sector transitions at low motor speeds. The Ping Method guarantees unidirectional motor start, which is independent of motor loading conditions. Thus, the system is robust with respect to system load conditions.

# 9.0 Wiring

For information regarding terminal assignments and function, see product datasheet. To ensure safe operation of the DPFlex, your application must meet the following requirements:



CAUTION: GENERAL WARNING Failure to comply with the requirements listed below may create an electrical hazard.

# 9.1 Power Cabling

Use two 16 AWG, 105 °C, twisted cables (with at least one twist per centimeter) made as short as possible to connect the DC power supply to the DPFlex.

Connect a 30 A fast blow fuse between the positive voltage from the DC power supply and J3 on the DPFlex.

It is recommended that an additional electrolytic capacitor be placed across J3/J4 on the DPFlex, as close as possible to the J3/J4 connectors. Rule of thumb sizing for this capacitor is 30  $\mu$ F per ampere of the DPFlex's rated current. Cables running to and from this added capacitor should be twisted together using 1 twist or more per centimeter.

If extra capacitance is used, it is highly recommended that a pre-charge circuit be used to limit the inrush current caused when charging this capacitance. The limiting resistor should then be shorted out using a relay or some other appropriate means.

Spot ground the DPFlex drive itself.

# 9.2 Motor Cabling

Use three 16 AWG, 105 °C, twisted cables (with at least one twist per centimeter) made as short as possible to connect the motor to the DPFlex.





Figure 3: Power and Motor Wiring Diagram

# 9.3 Communications Cabling

The signal cables for J1 must be less than 1 meter in length.

Use a USB cable to connect the PC to the USB-UART adapter.

The serial communications connector on the drive uses TTL signals. If communication with the drive from a device using standard RS-232 signals is desired, a means to convert the signal levels between the two devices must be provided.



# **10.0 Power Dissipation**

The DPFlex generates heat as power is consumed during operation. Note that the DPFlex requires an optimal heatsink in order to realize its full output power rating. Therefore heatsink the baseplate of the DPFlex using the following power dissipation curve as a guide. Note that the power dissipation curve was generated with balanced 3-phase sinusoidal current, at a 100 Hz fundamental and a 20 kHz switching frequency.



Figure 4: Power Dissipation Curve, DPFlex, 24 V, 30 A Model



Figure 5: Safe Operating Area, DPFlex, 24 V, 30 A Model



# **11.0 Getting Started**

# 11.1 Included Software

The software provided with the DPFlex drive includes DP.D, a Microsoft Windows based application that enables a user to configure and monitor the drive, and a USB-to-serial driver that enables a PC to communicate with the drive through a standard USB port.

To install and run the DP.D and USB-to-serial driver software, a PC is needed with the following minimum requirements:

- Windows XP with SP2 or higher
- A USB port or an RS-232 serial communication port capable of 115200 bps
- 133 MHz or higher Pentium-compatible microprocessor
- At least 64 MB of RAM
- 50 MB available hard drive storage
- SVGA or higher resolution monitor.

#### **11.2** Installing the Software

The DPFlex software is packaged on a CD-ROM containing the DP.D software and USB-to-serial driver, or may be downloaded from the company website.

To run the installation utility, insert the CD in your CD-ROM drive. Wait for the installation utility to auto run. If the installation utility does not automatically run, open the "SETUP.EXE" program found in the root of the CD.

Allied Motion Canada Inc.	
Home Install DP.D Install USB4o-Serial Driver	Welcome to Allied Motion & Thank You for choosing our Digital Power (DP) product. Allied Motion Canada is a world leader in the design, development and manufacturing of advanced motion control technology including motor control and power conversion. Our team is highly skilled in integrating power electronics, digital controls and network communications into small, compact and cost effective packages. Allied Motion has established customers in a broad range of industries and is based in Amherst, NY, USA. This version of DP.D supports:
Copyright <sup>©</sup> 2008 Allied Motion Canada Inc.	Windows 2000 with Service Pack 4 and above.     Windows XP Home/Professional with Service Pack 2 and above.     Windows Vista/7/8  Please contact us for more information. Allied Motion Canada Inc. 1200 Specers Road, Unit #48 Oakville, ON L6L 2X4 Canada ph: 519-886-2000
	Visit Allied Motion's Webpage www.alliedmotion.com.

Figure 6: Installation Utility, Main Menu



To install DP.D, in the installation utility, choose "Install DP.D". The installation utility launches the DP.D installation wizard. Follow the instructions in the wizard to install DP.D. Note that DP.D requires an Open Database Connectivity driver to be installed on the PC. If you do not have one, you can install one by running the "MDAC\_TYP.EXE" program in the "MDAC2\_8" directory found on the CD.



Figure 7: Installation Utility, Install DP.D

To install the USB-to-serial driver, in the installation utility, choose "Install USB-toserial Driver". The installation utility launches the driver installation wizard. If you want to change where the driver is installed, choose "Browse" to select another location. Then choose "Next" to install the driver or "Cancel" to abort the operation.



DP.D (v10.84)			
elect in allation Folde			
"he installer will install DP.D (v10.84) to	the following folder.		
o install in this folder, click "Next". To i	nstall to a different folder, ent	er it below o	r click "Browse".
<u>F</u> older:			
C:\Program Files (x86)\Allied Motion	n Canada Inc\DP.D (v10.84)\		B <u>r</u> owse
			Disk Cost
Install DP.D (v10.84) for yourself, or fo	or anyone who uses this comp	outer:	
Install DP.D (v10.84) for yourself, or fo	or anyone who uses this comp	outer:	
	or anyone who uses this comp	outer:	

Figure 8: Installation Utility, Install USB-to-Serial Driver

# **11.3** Connecting to the DPFlex

To configure the DPFlex drive using the installed DP.D software, it must be connected to power, to a motor, and to the PC.

Connect the DPFlex to the PC by plugging one end of the USB A to B cable into the USB port of the USB-UART adapter cable. Plug the free end of the USB A to B cable into a USB port on the PC. Note that if the USB-to-serial driver has not been installed, the PC will launch a device driver install wizard when it detects the adapter cable. Use the wizard to install the driver from the driver directory on the DP.D CD. Then, plug the free end of the adapter cable into the serial communications connector on the DPFlex drive then start DP.D.

When DP.D starts, it opens a blank System Navigation Tree which is used to create and manage DPFlex configuration(s).



Figure 9: DP.D System Navigation Tree



To add a DPFlex configuration, right-click the "System" branch in the System Navigation Tree and choose "Connection", or double-click the "System" branch. DP.D then displays the Interact form, which lists defined connections. Choose "Add".

nteract	×
Connections	
Add Delete	Properties
ОК	Cancel

Figure 10: Interact Form

DP.D then displays the Connection Info Form. If the port to which the DPFlex controller is connected is not displayed in the "Port" drop-down list, choose "Scan Ports". DP.D will then scan the PC for serial ports or the USB-to-serial adapter. If the USB port does not appear in the list, check the following items and re-scan: that the USB-to-serial driver is installed, that the USB-to-serial cables are properly connected.

In the "Port" drop-down list, choose the port to which the DPFlex controller is connected.

Connection Info	×
Serial Port Virtual	
Scan Ports	
Port Communications Port (COM1)	
Communications Port (COM1)	
OK Cancel	

Figure 11: Connection Info Form

Choose "Test" to confirm the connection to the controller is working. If the test fails, check the following items and re-test: that the communication cables are properly connected, that the DPFlex controller is powered.

Choose "OK" to accept the connection or "Cancel" to abort the operation. The Interact Form now lists the connection to the controller.



☞ COM4, Ena	bled	
Add	Delete	Properties

Figure 12: Interact Form (With Enabled Connection)

Choose "OK" to accept the controller connection configuration or "Cancel" to abort the operation. DP.D updates the System Navigation Tree for the new configuration.

	A DP_D.dpc - DP.D
	File View Tools Help
	⊡ Ę. System
	🗄 📟 Gen2_DPFlex1 (COM3)
	🗈 🔧 Stimulus Tools
ł	
l	
	E Faults
	- 📴 Registers
	🔤 Digital Output

Figure 13: DP.D System Navigation Tree (With Enabled Connection)

Each DPFlex configuration shows the enabled COM port and provides access to the following items: Stimulus Tools, Motor, Current Compensator, Velocity Compensator, Inputs, Faults, Registers, and Digital Output.

# **11.4** Saving Configurations

To save a DPFlex configuration, choose "File" -> "Save". If the configuration has not been previously saved, DP.D will display a browser by which to select a path and file name for the configuration file.

To create a new configuration, choose "File" -> "New". If the current configuration has not been saved, DP.D will prompt to either save or discard the configuration.

To open a configuration, choose "File" -> "Open". DP.D will display a browser. Select the path and file name for the desired configuration and choose "Open".



# 11.5 Loading New Firmware

To load new firmware and view system properties, right-click the "Gen2\_DPFlex (COMx)" leaf in the navigation tree and choose "Interact", or double-click the leaf. DP.D then displays the DPFlex System Properties Form.

) C Bus Voltage DC link bus voltage is set to 24 V	Controller Information
<< Hide Details	Tue Dec 09 11:12:23 2008 +5DST
	Voltage rating: 30 V
	<u></u>
	Load New Firmware

Figure 14: DPFlex Properties Form

The DPFlex Properties Form displays the following controller information: the supply voltage, drive temperature, the firmware version including date and time of compilation, and the DPFlex's current and voltage ratings.

To load new firmware, click "Show Details" -> "Load New Firmware". DP.D will then present a browser by which to select the appropriate path and file name.

# **12.0** Creating Applications

This chapter describes how to configure and deploy the DPFlex for a particular application, which includes: how to configure the DPFlex for a specific motor, tune the current and velocity control loops, check the digital and analog inputs, configure the digital output, monitor and clear drive faults, and use the DP.D digital oscilloscope.

# 12.1 Stimulus Tools

The Stimulus Tools allow the user to control either motor current, torque, or velocity from the DP.D interface.

Before using the Stimulus Tools, be sure to first successfully complete the Motor Verification process (see <u>Motor Parameters</u> for instructions), and input appropriate current and velocity loop gains (see <u>Current Compensator</u> and <u>Velocity Compensator</u>, respectively). Note that the Motor Verification process will provide initial current loop gains, however in some cases these settings should be fine-tuned using the Current Compensator.



# 12.1.1 Current Stimulus



The Current Stimulus Tool allows the user to command motor current or torque from the DP.D interface. Refer to the following figure and table for instructions.

Figure 15: Current Stimulus Tool

SETTING	DESCRIPTION
Rated Current	Shows the maximum current available from the DPFlex drive.
Motor Peak Current	Shows the value input as the motor's peak current rating through the "Motor Parameters" form.
Control Mode	Allows either "Current" or "Torque" as the control mode. In "Current" mode, the DPFlex will drive current through the motor phases, but the motor is not commutated. Used in conjunction with the digital oscilloscope, this function is useful for fine-tuning the current control loop. In "Torque" mode, current is controlled and the motor is commutated.
Control Source	Toggle between either "Host" control through the DP.D interface, or derive the command signal from the analog input. When using the Current Stimulus tool, the analog input signal (0 to 100%) maps to a minimum current command of zero to the given "Motor Peak Current".
Stop/Start	Enable or disable the drive output to the motor.
Direction	Use to inverse motor direction.
DC	Sets the current command to a constant value defined by the amplitude slider. The current amplitude is given as a percentage of the given "Motor Peak Current".
Pulse	Sets the current command to a square wave defined by the amplitude and frequency sliders. The current amplitude is given as a percentage of the given "Motor Peak Current".

Table 2:	Current	Stimulus	Tool,	Instructions
----------	---------	----------	-------	--------------



# 12.1.2 Velocity Stimulus

The Velocity Stimulus Tool allows the user to command motor velocity from the DP.D interface. Refer to the following figure and table for instructions.

Velocity - Gen2_DPFlex1	(COM14), Axis1_1	X
Starting Current 3.00 A Maximum Velocity 50000 RPM Actual Velocity 0.00% Control Source ( Host Analog Input Stop Start Direction	DC Value       100%         ●       0.00%         ●       60%         00%       40%         20%       20%         0%       55         Frequency       1Hz         10mHz       10mHz         10mHz       10mHz	10s
Rate Control 0.203997 0.203997	(seconds) Acceleration time to 100% of max RPM from 0 (seconds) Deceleration time to 0 from 100% of max RPM	

Figure 16: Velocity Stimulus Tool

SETTING	DESCRIPTION
Starting Current	The starting current is the current applied to the motor in order to move it from its initial stall position. This current must be large enough to overcome the static inertia of the motor plus the load.
Maximum Velocity	Enter the maximum permitted velocity.
Control Source	Toggle between either "Host" control through the DP.D interface, or derive the command signal from the analog input. When using the Velocity Stimulus tool, the analog input signal (0 to 100%) maps to a minimum velocity command of 3125 / (Motor Pole Pairs) to the given "Maximum Velocity".
Stop/Start	Enable or disable the drive output to the motor.
Direction	Use to inverse motor direction.
DC	Sets the velocity command to a constant value defined by the amplitude slider. The velocity amplitude is given as a percentage of the given "Maximum Velocity".
Pulse	Sets the velocity command to a square wave defined by the amplitude and frequency sliders. The velocity amplitude is given as a percentage of the given "Maximum Velocity".
Rate Control	Establish the motor's rate of acceleration/deceleration by entering a value of time corresponding to the interval within which to accelerate/decelerate between zero and the input Maximum Velocity. A value of 0 in the edit box deactivates Rate Control.

Table 3:	Velocity	Stimulus	Tool,	<b>Instructions</b>
----------	----------	----------	-------	---------------------



# **12.2** Motor Parameters

Use the Motor Parameters Form to input the motor's number of pole pairs (e.g. for a six pole motor, the number of pole pairs is three) and its rated peak current. Choose "Apply" to update the motor parameters.

By default, the DP.D software will automatically calculate a set of current loop gains for the DPFlex, targeting optimal control about a load point of 20% of the "Motor Peak Current". If during operation the motor is expected to operate above this 20% threshold, increase the percentage to reflect the application specific load point. Note that while the Motor Verification process provides initial current loop gains, in some cases these settings should be fine-tuned using the <u>Current Compensator</u>.

Motor Type Brushless	Motor Settings Number of Pole Pairs
fotor Verification Too	Motor Peak Current
	Start
and the second	of motor peak current.
Use   20.00 % =	

Figure 17: Motor Form

# 12.2.1 Motor Verification Tool



#### CAUTION: GENERAL WARNING

Failure to ensure that the motor is fixed in place, not connected to a load, and that the shaft can turn freely may result in improper configuration and damage to equipment or injury to personnel.

After the appropriate motor parameters have been applied, choose "Start" to begin the Motor Verification process.

otor Verification Tool	
Press the continue button to begin setup pr	ocess.
The motor verification tool will:	
<ul> <li>Determine ph-to-ph motor resistance and i</li> </ul>	nductance.
<ul> <li>Determine startup parameters.</li> </ul>	
Caution: Motor will move during the setup p	rocess
The motor frame should be tied down.	
	CONTRACT OF CONTRACT.
<ul> <li>The motor shaft should be able to move fr</li> </ul>	eely.
<ul> <li>The motor shaft should be able to move fr</li> <li>Pressing the 'STOP' button at any time will</li> </ul>	

Figure 18: Motor Verification Tool



During the Motor Verification process, the DP.D software detects the motor's inductance and resistance values and determines the appropriate sensorless startup settings. To accomplish this, the DPFlex will output to the motor the defined "Motor Peak Current" in order to saturate the motor phases. Note that if Motor Verification fails, it is likely that the "Motor Peak Current" is not set to a sufficiently high value. To resolve, increase the "Motor Peak Current" setting.

After the tool has finished, close the Motor Verification Tool and save the configuration parameters to the DPFlex's non-volatile memory by navigating to "Registers" -> "Update Registers" in the System Navigation Tree.

# 12.3 Current Compensator

The current loop is a discrete control loop nested inside of the discrete velocity loop that ensures the targeted current setpoint is achieved and maintained.

The Current Compensator Form displays the current gains set for the target motor. It also enables the user to re-calculate the gains based on the motor parameters, or to tune the gains manually using DP.D's tuning tools.

Calculate G	ains Based On Motor	Parameters
urrent Gains		V V V
Кр 0.000 🛨	Ki 0.000 🛨	Kd 0.000
		7
		Tuning Tools

Figure 19: Current Compensator Form

Choosing "Tuning Tools" will display the Oscilloscope and the Current Stimulus forms. Note that these forms can be arranged as desired and their positions saved by using the "View" -> "Save Windows" command. The forms can then be restored to their saved positions any time by choosing "View" -> "Restore Windows".



Oscilloscope			
🖆 🖬 🖨 🖼 iiii 🖕 👖 🗾 🔳	👷 🔍 🔍 打 🔶 🗶 0.00ms	S Y: 0.00 Current - DPFlex1 (COM4), Axis1_1	×
		Rated Current     Maximum     100%       30.00 A     50.00%     75%       00.00 A     DC     50%       Control Mode     DC     50%       Control Source     Minimum     25%       Host     40.00%     0%	0.1s
0.00ms CHI Drive Current Setpoint DPFlext (CDN4) CH2 Drive Current Actual DPFlext (CDM4) CH3 CH3 CH3 CH4 Manual Trigger Single Auto	/ m <sup>6</sup> scoss 5s 30 2.50 ms/Div 20− Datalog 10 Rate ± 0.25 ms	Settings         Calculate Gains Based On Motor Parameters           Calculate Gains Based On Motor Parameters           Current Gains           K × of 25 ms           10         50 so           700           -80	

Figure 20: Current Compensator, Tuning Tools

When tuning the current loop, make sure the motor shaft is connected to the required load, that the load is free to move and can move safely, and that the motor itself will not move when turning.



#### CAUTION: GENERAL WARNING

Failure to ensure that the motor shaft is connected to the required load, that the load is free to move and can move safely, and that the motor itself will not move when operating may result in improper configuration and damage to equipment or injury to personnel.

To manually tune the current loop gains, in the Current Stimulus Form choose "Current Mode" and "Pulse". Set the desired values for current pulse frequency and amplitude. Then select "Start" to apply current to the motor. In the Oscilloscope Form, choose "Auto" to start triggering. After a few seconds, the Oscilloscope will display the current stimulus in green and the actual current draw in red. Adjust the current loop gains such that rise time, ringing, and overshoot are minimized.





Figure 21: Oscilloscope, Current Loop Tuning

# 12.4 Velocity Compensator

The velocity loop is a discrete control loop which issues current commands to the current control loop such that the desired velocity setpoint is achieved and maintained.

The Velocity Compensator Form displays the velocity gains set for the target motor. It also allows the user to tune the gains manually using DP.D's tuning tools.

Velocity Gains	Ki 0.000 ÷	Kd 0.000 +
		Tuning Tools
		Tuning Tools

Figure 22: Velocity Compensator Form



Choosing "Tuning Tools" will display the Oscilloscope and the Velocity Stimulus forms. Note that these forms can be arranged as desired and their positions saved by using the "View" -> "Save Windows" command. The forms can then be restored to their saved positions any time by choosing "View" -> "Restore Windows".



Figure 23: Velocity Compensator, Tuning Tools

When tuning the velocity loop, make sure the motor shaft is connected to the required load, that the load is free to move and can move safely, and that the motor itself will not move when turning.



# CAUTION: GENERAL WARNING

Failure to ensure that the motor shaft is connected to the required load, that the load is free to move and can move safely, and that the motor itself will not move when operating may result in improper configuration and damage to equipment or injury to personnel.

To manually tune the velocity loop gains, in the Velocity Stimulus Form choose "Pulse". Set the desired values for velocity pulse frequency and amplitude. Then select "Start" to apply the velocity command to the motor. In the Oscilloscope Form, choose "Auto" to start triggering. After a few seconds, the Oscilloscope will display the velocity stimulus in green and the actual velocity in red. Adjust the velocity loop gains such that rise time, ringing, and overshoot are minimized.





Figure 24: Oscilloscope, Velocity Loop Tuning

# 12.5 Inputs

The Inputs Form allows the signals on the input pins to be monitored. Note that while monitoring the input pins through DP.D, the drive is disabled.

r		
Inputs - Gen2_DPFlex1 (COM3)		X
Analog Input	Digital Inputs Active High	•
0% 40% 60% 80% 100%	Input One	
0.10% Input Voltage Source 0-5 V 20k pot		

Figure 25: Inputs Form



The "Analog Input" indicator shows the percentage of input voltage across the analog input. When "0-5V" is selected, 0 to 5 V scales from 0 to 100%. When "20k pot" is selected, 0 to 3.3 V scales from 0 to 100%.

Two digital inputs are available on the DPFlex. Digital input 1 provides an enable/disable signal and digital input 2 signals direction. Note that motor direction cannot be changed after the DPFlex has been enabled. "Input One" and "Input Two" indicators turn bright red when signal voltage is applied across the corresponding inputs. Use the drop-down menu to configure the digital inputs to be either "Active High" or "Active Low".

# 12.6 Faults

Use the "Status" tab to view the operational status of the DPFlex and motor. Choose "Refresh" to update the display with the current status. Choose "Clear Faults" to clear the display and update the status. Note that faults are also cleared by power cycling the drive.

nterface		*
Vone		
Axis1_1		
lone		
		7

Figure 26: Faults, Status Form

Use the "Configure" tab to adjust fault settings, states, warnings, and error messages. Set thresholds by entering values for temperature, current, and voltage in degrees Celsius, amperes, and volts, respectively. Choose "Apply" to save settings.



ults - I	DPFlex1 (COM4)
Status	Configure
Tem	iperature
٧	Vam when temperature exceeds 芸 85 °C
Shu	t down when temperature reaches 90 °C
Cur	ent
1	Warn when the current exceeds 😴 31.50 A
Sh	ut down when the current reaches 34.50 A
Volt	age
1	Nam when the voltage exceeds 🕂 31 V
Sh	ut down when the voltage reaches 34V
	Apply

Figure 27: Faults, Configure Form

# 12.7 Registers

The Registers Form allows the user to retrieve and save DPFlex settings as (\*.dpr) files, and to load those settings to DPFlex's non-volatile memory. Also use the Registers Form to configure the drive Auto Start mode. Note that changes to the Auto Start settings will not take effect until after selecting "Update Registers", disconnecting the drive from DP.D, and then power-cycling the DPFlex.

egisters	DPFlex1 (COM4)	
	Auto Start 💌	
Start-up	with fixed torque setpoint	
	Fixed Torque 式 30.00 A	
Update F	egisters to Flash Update Registers	
Save Re	gisters to File from Flash	
	Save Registers	
Load Reg	jisters from File to Flash	
	Load Registers	

Figure 28: Registers Form



SETTING	DESCRIPTION
Auto Start	Drive will enable itself when main power is applied.
Start on Enable Input	Drive will enable itself when main power is applied and digital input 1 is active.
Start-up with fixed torque setpoint	When the drive is enabled, it will commutate the motor with a constant torque output defined by "Fixed Torque".
Start-up with analog input torque setpoint	When the drive is enabled, it will commutate the motor with a torque output defined by the analog input. The analog input signal (0 to 100%) maps to a minimum torque command of zero to the given "Maximum Torque".
Start-up with fixed velocity setpoint	When the drive is enabled, it will commutate the motor with a constant torque output defined by "Fixed Velocity". Also input a value for "Starting Current". The starting current is the current applied to the motor in order to move it from its initial stall position. This current must be large enough to overcome the static inertia of the motor plus the load.
Start-up with analog input velocity setpoint	When the drive is enabled, it will commutate the motor with a velocity output defined by the analog input. The analog input signal (0 to 100%) maps to a minimum velocity command of 3125 / (Motor Pole Pairs) to the given "Maximum Velocity". Also input a value for "Starting Current". The starting current is the current applied to the motor in order to move it from its initial stall position. This current must be large enough to overcome the static inertia of the motor plus the load.
Update Registers	Store present settings configured in DP.D to the DPFlex's non-volatile memory.
Save Registers	Save present settings stored in the DPFlex's non-volatile memory to the PC as a (*.dpr) file.
Load Registers	Load settings stored on the PC as a (*.dpr) file to the DPFlex's non-volatile memory.

# Table 4: Registers Form, Instructions

# 12.8 Digital Output

The digital output can be configured to be either a speed indicator or a fault indicator. When configured to be a speed indicator, the output will change state once every 60 electrical degrees. When configured to be a fault indicator, the digital output will activate when a drive fault occurs.

Figure 29: Digital Output Form



# **12.9** Using the Oscilloscope

DP.D features a four-channel digital oscilloscope that enables a user to view target setpoints and the motor's actual performance. To display the digital oscilloscope, take one of the following actions:

- In the "Tools" menu, choose "Oscilloscope".
- In the Current Compensator form or Velocity Compensator forms, choose "Tuning Tools".



Figure 30: Oscilloscope



SETTING	DESCRIPTION
CH1 through CH4	Use to assign a signal to a channel.
Manual Trigger	Select to trigger data logging once immediately.
Single	Select to trigger data logging once.
Auto	Select to trigger data logging continuously and to display captured data.
Time Base	Use the dial to specify the time per division to be displayed on the oscilloscope screen (e.g. 100 ms/Div). For any given number of "Points" (e.g. 100) to be captured, the "Rate" at which these points are captured will be updated in the "Datalog" field to reflect this change (e.g. one data point captured every 10 ms).
Datalog	Specify the "Rate" at which data is captured (e.g. one data point captured every 10 ms), and the total number of "Points" to be captured (e.g. 100). For any given input, the time per division displayed in "Time Base" will be updated to reflect these changes (e.g. 100 ms/Div).
Ð	Zoom in on the selected segment of the graph.
Q 1⊥ ◆	Zoom out of the selected segment of the graph.
₹ <u>↓</u>	Rescale the display to the input signals' range.
+	Show or hide the cursor.
	Open an oscilloscope configuration.
	Save the current oscilloscope configuration.
8	Print the captured data points.
围	Copy all captured data points to the clipboard.
55	Display inputs as graphs.
	Display inputs in a table.
4	Display scaled data.
	Position the cursor on the selected input.
⊕.	Zoom out on the graph to show all captured data points.

# Table 5: Oscilloscope, Instructions

# **13.0** Control Theory & Implementation

The DPFlex drive and motor system can be modelled as shown in the diagram below. Except for the plant (the motor and its load), all of the blocks in the diagram are parts of the DPFlex. Note that the current and velocity control loops within the DPFlex form a nested pair, with the velocity loop outputing current commands to the current loop, and the current loop outputting current to the motor. For the sake of this analysis, only the inner current loop is shown in the diagram; note that the velocity loop surrounding the current loop shares an identical structure. Also the plant is taken to be the R-L transfer function of a BLDC motor.





Figure 31: System Diagram

In both the current and velocity control loops, two main goals must be achieved:

- Keep the output (in this case, current in the motor phases and velocity of the rotor) as close as possible to the target setpoint. The result is referred to as the steady state response.
- Maintain an acceptable response to a change in setpoint. This is called the dynamic response.

To achieve these two goals, a second order infinite impulse response filter (biquad compensator) is used to approximate a classic PID control loop.

# **13.1 Biquad Compensator**

A classic PID control loop can be approximated in the discrete time domain by a  $2^{nd}$  order IIR filter with the following z-domain transfer function.

Equation 1: Transfer Function, Biquad Compensator, z-Domain  $H(z) = \frac{Y(z)}{X(z)} = \frac{B_0 + B_1 z^{-1} + B_2 z^{-2}}{1 + A_1 z^{-1} + A_2 z^{-2}}$ 

This transfer function has the following block diagram:



Figure 32: Biquad Filter Diagram



# **13.2** Calculating Filter Coefficients

DP.D automatically calculates the biquad filter coefficients ( $B_n$  and  $A_n$ ) from the classic PID control loop gains ( $K_p$ ,  $K_i$ , and  $K_d$ ). Biquad coefficients are values described in Q1.15 format with exponent value. Most good digital signal-processing texts contain a description of the Q1.15 numerical format.

The transfer function of the PID compensator in the s-domain is:

Equation 2: Transfer Function, PID Compensator, s-Domain  $G(s) = \frac{Y(s)}{X(s)} = K_p + \frac{K_i}{s} + K_d s$ 

To find out how PID gains are related to biquad gains, assume that  $s = \frac{z}{z-1}$ , which is an approximation of the bilinear transformation. Then transforming Equation 2 to the z-domain yields:

Equation 3: Transfer Function, PID Compensator, z-Domain  $G(z) = \frac{Y(z)}{X(z)} = \frac{(K_p + K_i + K_d) + (-K_p - 2K_d)z^{-1} + (K_d)z^{-2}}{1 - z^{-1}}$ 

and by comparing Equation 1 and 3:

Equation 4: Biquad Compensator Coefficient  $A_1$  $A_1 = 1$ 

Equation 5: Biquad Compensator Coefficient  $A_2$  $A_2 = C$ 

Equation 6: Biquad Compensator Coefficient  $B_0$  $B_0 = (K_p + K_i + K_d)$ 

Equation 7: Biquad Compensator Coefficient  $B_1$  $B_1 = (-K_p - 2K_d)$ 

Equation 8: Biquad Compensator Coefficient  $B_2$  $B_2 = (K_d)$ 

Equations 4 through 8 show how each of the five biquad filter coefficients are calculated from the classic PID control loop gains  $(K_p, K_i, \text{ and } K_d)$  whose values are input through DP.D for both the current and velocity control loops.



User Manual: DPFlex Gen 2

# 14.0 Contacts and Service

For technical support, sales, or service repair, please visit our website and/or contact:

# NORTH AMERICA 1 (888) 392-5543 E-mail: inquiry@alliedmotion.com

# EUROPE +46 (8) 546 11 100 E-mail: inquiry@alliedmotion.com

# ASIA +852 2607 4038 E-mail: inquiry@alliedmotion.com

# 15.0 Revision History

REVISION	DESCRIPTION OF CHANGE	DATE		
R1	Initial release.	February 12, 2015		
R2	Removed "Trigger Settings" instructions not implemented in DP.D v10.88. Added hot surface warning, disclaimers, wiring instructions and diagram, references to product datasheet, and service contacts. Reorganized sections.	April 17, 2015		
R3	Removed PCB only mounting instructions. Added instructions for acceleration and deceleration limits in the Velocity Stimulus tool.	June 2, 2015		

# Table 6: Revision History